

St Tammany Parish, LA


CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 14:37	MANHOLE NO.: 06-091
SEGMENT LENGTH: 295	LENGTH METHOD: Measured	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 14:40	MANHOLE NO.: 06-092
SEGMENT LENGTH: 306	LENGTH METHOD: Measured	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 14:44	MANHOLE NO.: 06-088
SEGMENT LENGTH: 350	LENGTH METHOD: Estimated	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-088DF01A

PHOTO# 06-088DF01G

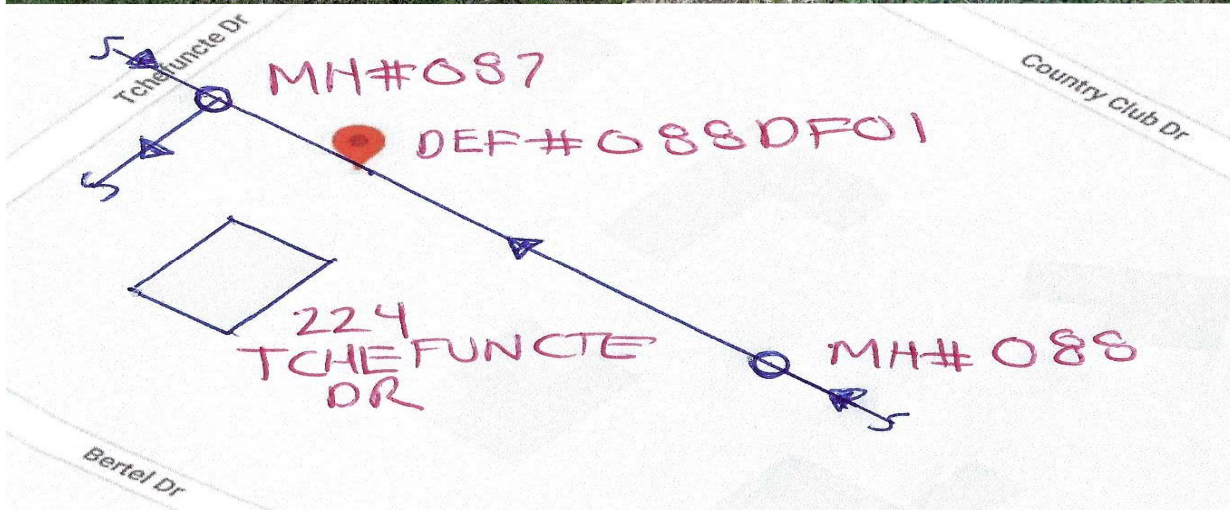

DEFECT NO.: 01	AREA PHOTO NO.: 06-088DF01A	GPS PHOTO NO.: 06-088DF01G
DEFECT TYPE: Broken Cleanout	SMOKE INTENSITY: Medium	INFLOW POTENTIAL: Moderate
SURFACE LOCATION: Back Yard	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 224Bertel Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 698415.19600	EASTING: 3669382.32700
COMMENTS:		

St Tammany Parish, LA


CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 14:56	MANHOLE NO.: 06-089
SEGMENT LENGTH: 385	LENGTH METHOD: Estimated	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 15:39	MANHOLE NO.: 06-090
SEGMENT LENGTH: 545	LENGTH METHOD: GPS	SMOKE QUALITY: Poor	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 15:53	MANHOLE NO.: 06-053
SEGMENT LENGTH: 219.8	LENGTH METHOD: GPS	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-053DF01A

PHOTO# 06-053DF01G

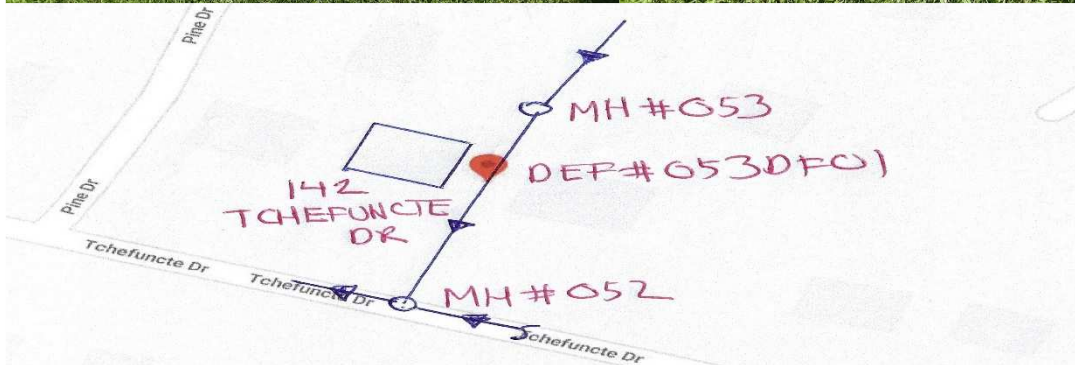

DEFECT NO.: 01	AREA PHOTO NO.: 06-053DF01A	GPS PHOTO NO.: 06-053DF01G
DEFECT TYPE: Mainline	SMOKE INTENSITY: Medium	INFLOW POTENTIAL: Moderate
SURFACE LOCATION: Yard	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 142Tchefuncte Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 696231.85600	EASTING: 3672153.04100
COMMENTS:		

St Tammany Parish, LA

CREW LEADER: D. Lumas	DATE: 2020/06/04	TIME: 16:01	MANHOLE NO.: 06-054
SEGMENT LENGTH: 443	LENGTH METHOD: GPS	SMOKE QUALITY: Poor	
POSITIVE DEFECTS: No	COMMENTS:		


CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 13:34	MANHOLE NO.: 06-063
SEGMENT LENGTH: 547	LENGTH METHOD: Measured	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 13:36	MANHOLE NO.: 06-063.01
SEGMENT LENGTH: 513	LENGTH METHOD: Measured	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 13:38	MANHOLE NO.: 06-061
SEGMENT LENGTH: 228.9	LENGTH METHOD: GPS	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-061DF01A

PHOTO# 06-061DF01G

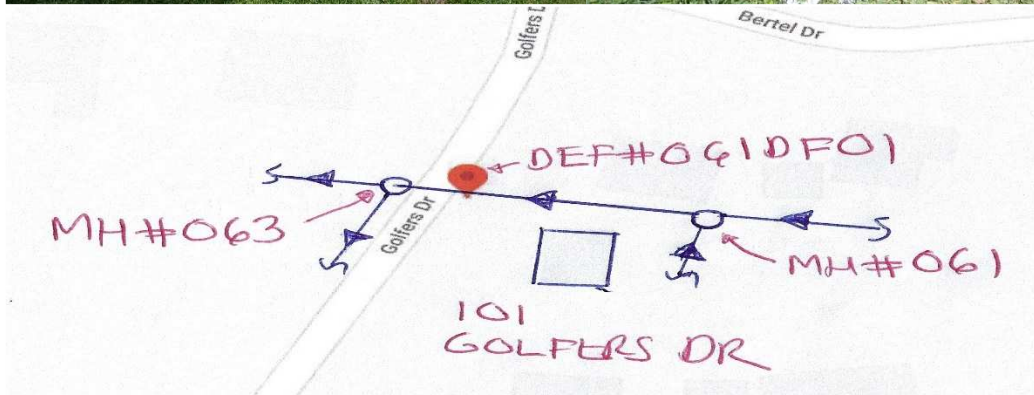

DEFECT NO.: 01	AREA PHOTO NO.: 06-061DF01A	GPS PHOTO NO.: 06-061DF01G
DEFECT TYPE: Direct Storm Drain	SMOKE INTENSITY: Thick	INFLOW POTENTIAL: Severly
SURFACE LOCATION: Road Shoulder	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 101 Golfers Dr.
ACCESSIBLE TO DEFECT: Public Property	NORTHING: 697402.03000	EASTING: 3671458.31700
COMMENTS:		


St Tammany Parish, LA

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 13:42	MANHOLE NO.: 06-062
SEGMENT LENGTH: 547.3	LENGTH METHOD: GPS	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-062DF01A



PHOTO# 06-062DF01G

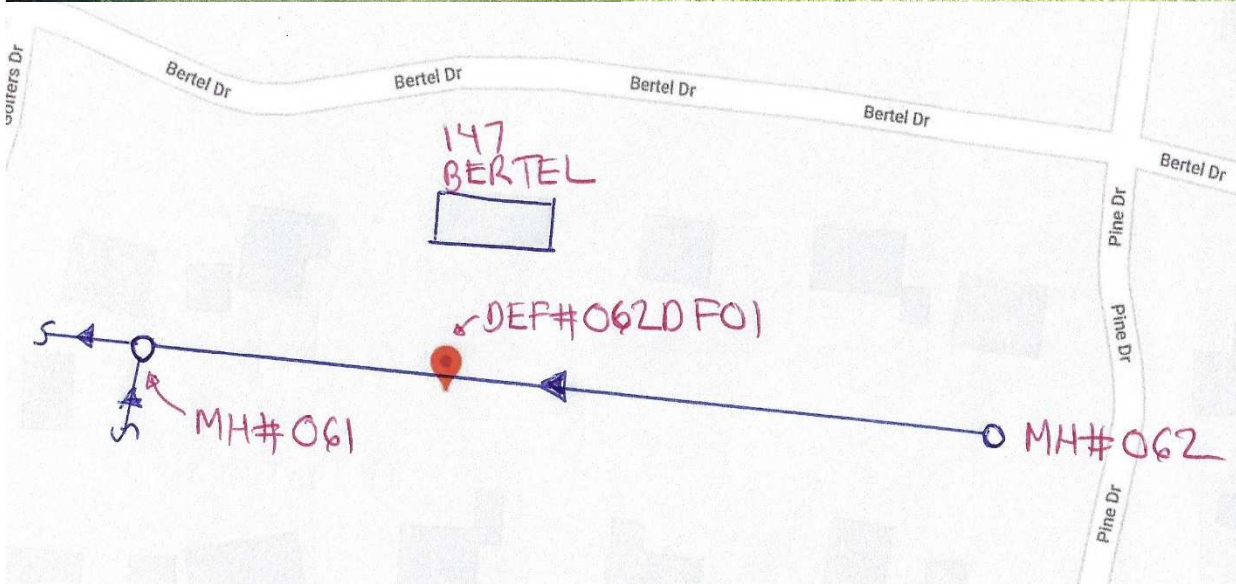

DEFECT NO.: 01	AREA PHOTO NO.: 06-062DF01A	GPS PHOTO NO.: 06-062DF01G
DEFECT TYPE: Multiple Leaks	SMOKE INTENSITY: Medium	INFLOW POTENTIAL: Heavy
SURFACE LOCATION: Easement	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 147 Bertel Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 697355.29700	EASTING: 3671812.07200
COMMENTS:		


St Tammany Parish, LA

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 15:32	MANHOLE NO.: 06-021
SEGMENT LENGTH: 260	LENGTH METHOD: GPS	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-021DF01A



PHOTO# 06-021DF01G

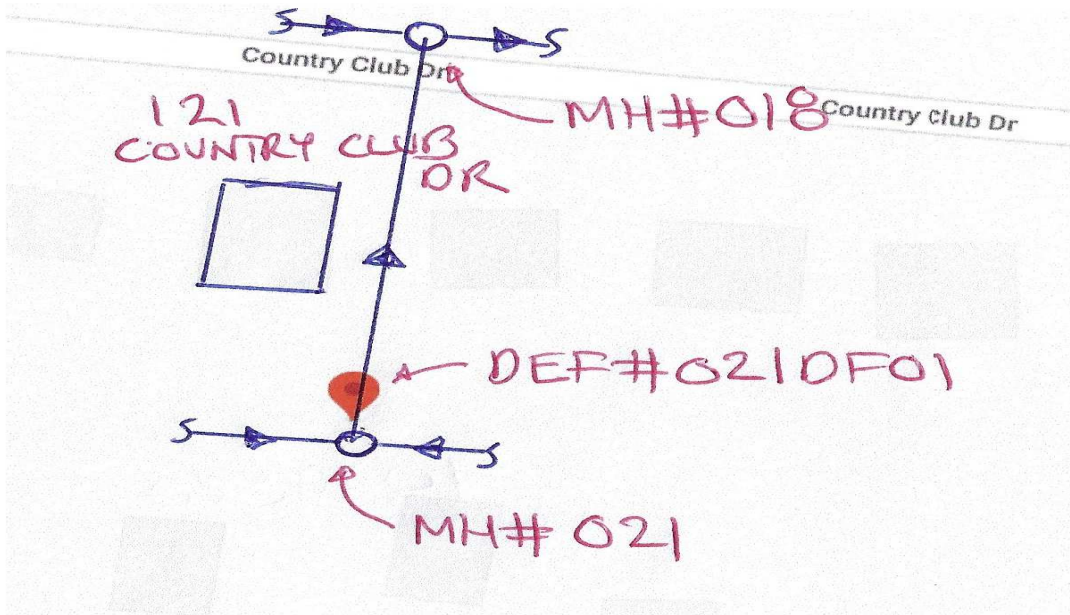

DEFECT NO.: 01	AREA PHOTO NO.: 06-021DF01A	GPS PHOTO NO.: 06-021DF01G
DEFECT TYPE: Hole	SMOKE INTENSITY: Light	INFLOW POTENTIAL: Moderate
SURFACE LOCATION: Back Yard	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 121 Country Club Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 697659.70100	EASTING: 3673374.44300
COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 15:36	MANHOLE NO.: 06-022
SEGMENT LENGTH: 295	LENGTH METHOD: GPS	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		


St Tammany Parish, LA

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 13:43	MANHOLE NO.: 06-023
SEGMENT LENGTH: 300	LENGTH METHOD: Estimated	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-023DF01A



PHOTO# 06-023DF01G

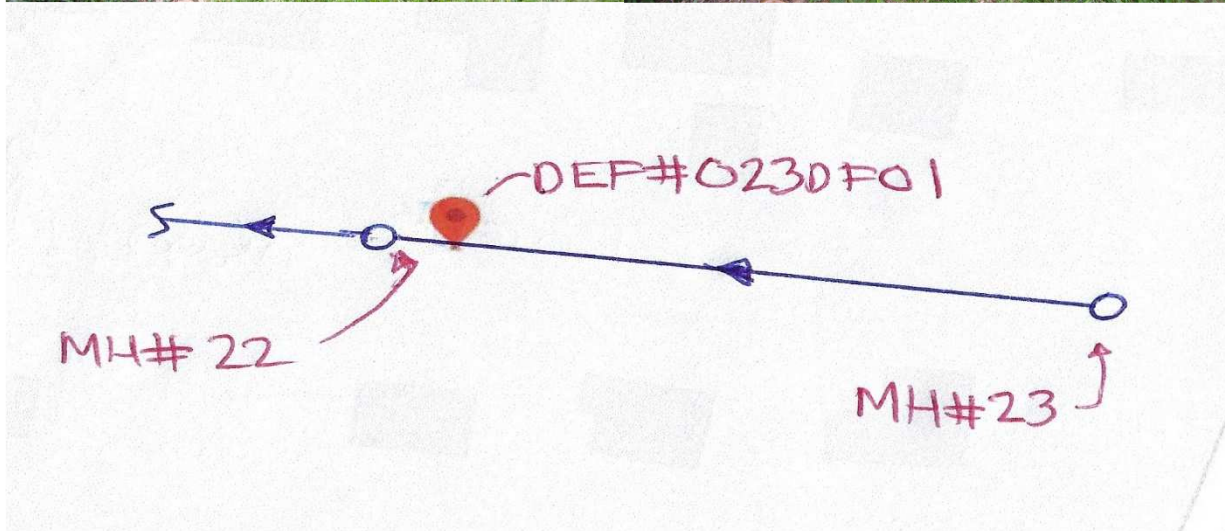

DEFECT NO.: 01	AREA PHOTO NO.: 06-023DF01A	GPS PHOTO NO.: 06-023DF01G
DEFECT TYPE: Cleanout Cap Broken	SMOKE INTENSITY: Light	INFLOW POTENTIAL: Chance is Slim
SURFACE LOCATION: Back Yard	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 108 Bertel Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 697586.13900	EASTING: 3673922.05000
COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 15:48	MANHOLE NO.: 06-024
SEGMENT LENGTH: 480	LENGTH METHOD: Estimated	SMOKE QUALITY: Good	
POSITIVE DEFECTS: No	COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 13:51	MANHOLE NO.: 06-025
SEGMENT LENGTH: 440	LENGTH METHOD: Estimated	SMOKE QUALITY: Poor	


St Tammany Parish, LA

POSITIVE DEFECTS: No	COMMENTS:
-----------------------------	-----------

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 16:09	MANHOLE NO.: 06-016
SEGMENT LENGTH: 437	LENGTH METHOD: GPS	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-016DF01A

PHOTO# 06-016DF01G

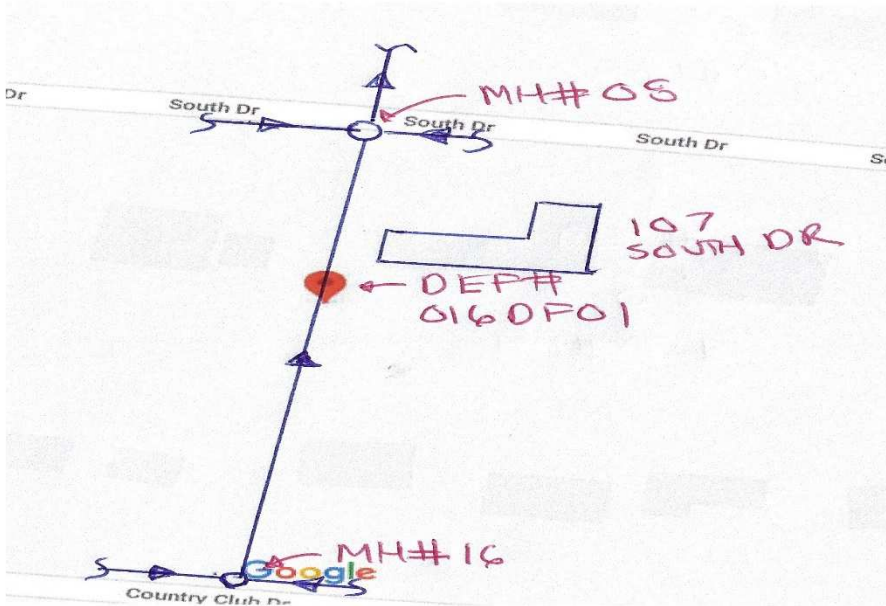

DEFECT NO.: 01	AREA PHOTO NO.: 06-016DF01A	GPS PHOTO NO.: 06-016DF01G
DEFECT TYPE: Hole	SMOKE INTENSITY: Thick	INFLOW POTENTIAL: Severly
SURFACE LOCATION: Drainage Ditch	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 107 South Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 698120.20700	EASTING: 3673921.54500
COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 16:36	MANHOLE NO.: 06-008
SEGMENT LENGTH: 240	LENGTH METHOD: Estimated	SMOKE QUALITY: Good	


St Tammany Parish, LA

POSITIVE DEFECTS: No	COMMENTS:
-----------------------------	-----------

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 16:34	MANHOLE NO.: 06-002
SEGMENT LENGTH: 230	LENGTH METHOD: Estimated	SMOKE QUALITY: Good	
POSITIVE DEFECTS: Yes	COMMENTS:		

PHOTO# 06-002DF01A

PHOTO# 06-002DF01G

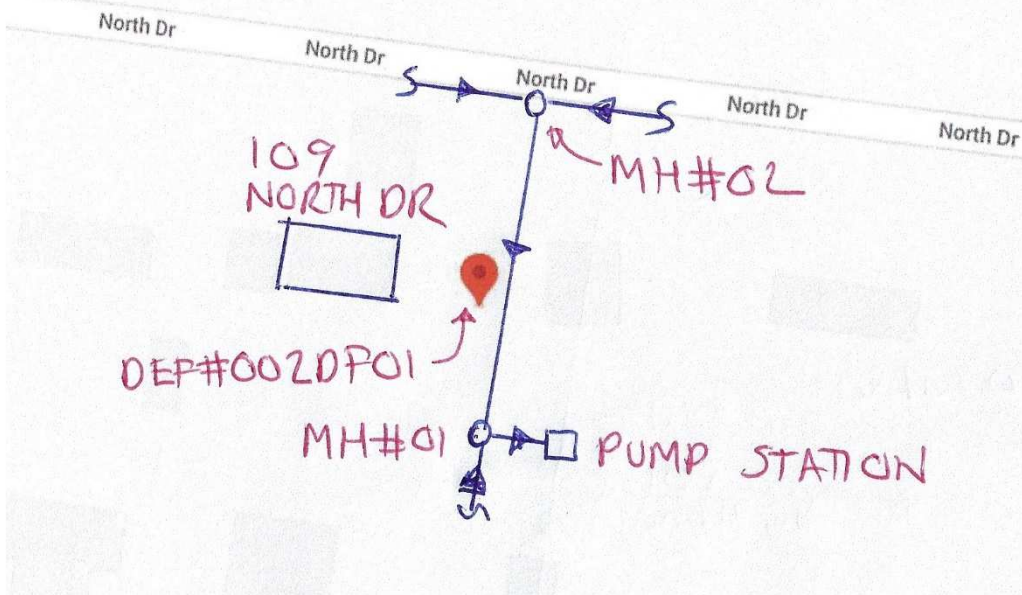

DEFECT NO.: 01	AREA PHOTO NO.: 06-002DF01A	GPS PHOTO NO.: 06-002DF01G
DEFECT TYPE: Missing Cleanout Cap	SMOKE INTENSITY: Thick	INFLOW POTENTIAL: Heavy
SURFACE LOCATION: Drainage Ditch	SURFACE MATERIAL: Sod/Dirt	ADDRESS: 109 North Dr.
ACCESSIBLE TO DEFECT: Private Property	NORTHING: 698625.26200	EASTING: 3673997.75400
COMMENTS:		

CREW LEADER: D. Lumas	DATE: 2020/06/05	TIME: 16:58	MANHOLE NO.: 06-069
------------------------------	-------------------------	--------------------	----------------------------

St Tammany Parish, LA

SEGMENT LENGTH:	320	LENGTH METHOD:	Estimated	SMOKE QUALITY:	Poor
POSITIVE DEFECTS:	No	COMMENTS:			